SWAG 20 94 5192

Land Rover Freelander TD4, Range Rover TD6



Breather Valve for crankcase, with additional parts

Problem

Engine oil leak, usually from the dipstick tube, because the dipstick has been pushed out under pressure.

Other symptoms include lack of engine power; the engine will not increase in speed, black or blue exhaust smoke and excessive oil consumption.

Cause

Excessive crankcase pressure caused by a blocked crankcase breather filter, this is located in the depression control valve assembly, which is fitted to the camshaft cover.

Solution

Replace the blocked filter and the complete breather valve assembly. Clean any excess oil leaks and test.